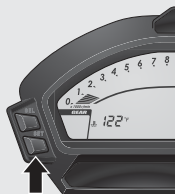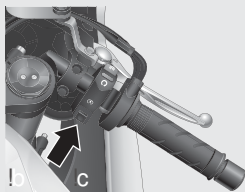## Instruments *(Continued)*
Measurement of lap time

!b !d

SET button

!c Start/lap button

!a Switch the display to the lap time mode.
(P36)

!b Press SET button or start/lap button then start measuring.

While measuring 1 lap

Time (count up display)

Lap number

!c Press start/lap button at each lap.

In completion of 1 lap

Most Recent lap time
(When driving time display: After 5 seconds switch to driving time.)

Number of completed laps

In completion of 21 laps

!d Press SET button to end the measurement.
u During the measurement, switching to other modes is not available.