



Place spindle punch mark and ratchet punch mark horizontally up, push ratchet into spindle and assemble

Install spring

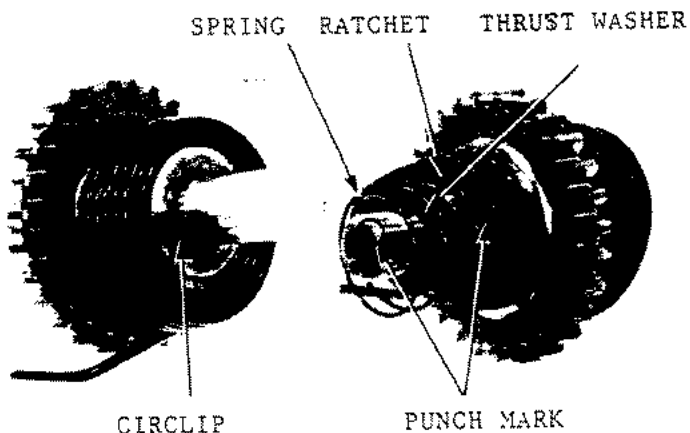


Install kickstarter pin such that the return spring and the R. crankcase groove meet

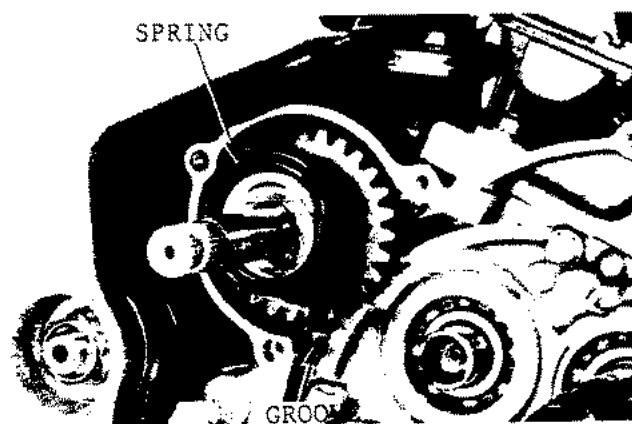

KICKSTARTER IDLE GEAR INSTALLATION

Install thrust washer into countershaft

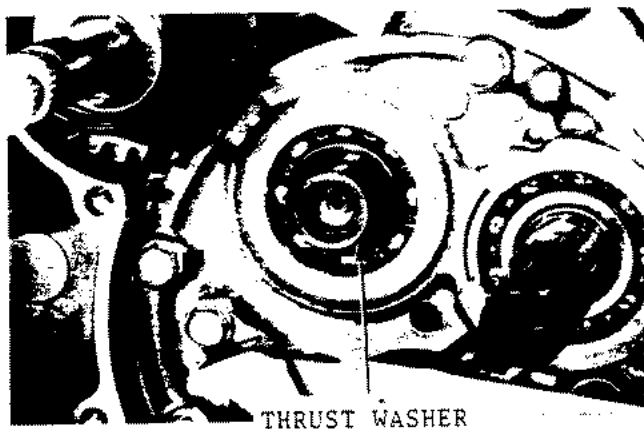

Apply molybdenum grease to idle gear
Install idle gear, thrust washer and snap ring into countershaft

